

## TROUBLESHOOTING

PROBLEM	CAUSE	SOLUTION
Cistern leaning forward after assembly to pan.	Outlet valve not centred and interfering with pan ceramic when assembled.	Remove cistern, loosen outlet valve and ensure it is centred with hole in bottom of ceramic cistern. Tighten and re-assemble.
	Rough or inclined floor.	Check finished floor is flat and horizontal.
Water leaking into bowl.	Leaking outlet valve caused by debris in bottom of cistern stopping valve properly closing after flush.	Turn off stop cock.
		Remove outlet valve and clear debris.
	Leaking outlet valve caused by incorrectly installed or faulty seal.	Replace seal.
	Leaking Inlet valve.	Clean inlet valve.
		Replace inlet valve.
Water leaking onto floor.	S or P-trap waste connector leaking.	Remove pan and re-install connector ensuring proper sealing of connector to ceramic outlet.
	Stop-cock or mini-tap leaking.	Tighten or replace stop-cock or mini-tap.
	Cistern bolts incorrectly installed.	Tighten cistern bolts.
	Donut seal incorrectly installed.	Remove cistern and replace ensuring donut seal is centred around outlet valve assembly nut.
Slow or noisy cistern refill.	Stop-cock or mini-tap not fully open.	Ensure top-cock or mini-tap fully open.
Loose seats.	Hinge pin bolts are loose.	Remove seat and tighten hinge pin bolts. (Refer seat installation guide)
Toilet seat or cover slamming closed.	Soft close hinges are faulty or damaged.	Replace soft close hinges- available as a spare part.

## WARRANTY

Please refer to our website for full warranty terms and conditions:

https://parisi.com.au/pages/warranty-information



## WALL FACED SUITE INSTALLATION INSTRUCTIONS

PARISI

PN600 ELLISSE

PN700 SLIM

PN730 L'HOTEL

PN760 LINFA

PN800 ELLISSE ACCESSIBLE

PN820 ELLISSE AMBULANT

PN900 ENVY III

















4 November 2023


## **INSTALLATION**


INSTALLATION AND TESTING TO BE UNDERTAKEN IN ACCORDANCE WITH RELEVANT PLUMBING STANDARDS. PLEASE CHECK THAT ALL PARTS ARE INCLUDED AND COMPONENTS ARE NOT DAMAGED.

DO NOT INSTALL ANY DAMAGED COMPONENTS. CONTACT POINT OF PURCHASE FOR REPLACEMENT.

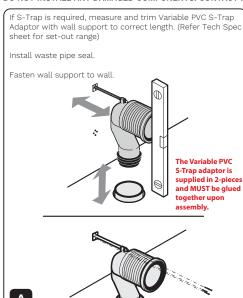

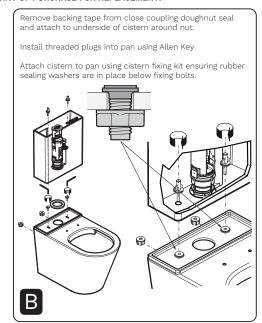

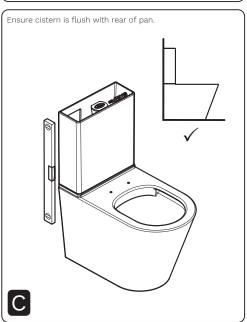

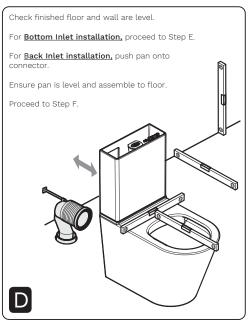

Bottom Inlet installation, attach mini stop tap to the wall outlet. Connect the flexi-hose to mini stop tap.

Open tap & flush line into a bucket until water runs clean.

Feed hose into bottom inlet access hole on side of pan and attach to Inlet Extension.

Check for debris in botttom of cistern and clean if required. Push pan onto connector

Ensure pan is level and assemble to floor.

Proceed to Step H.

Recommended hose configuration for PN900



Back Inlet installation install the Mini Stop tap to wall outlet.

Ensure outlet of tap is pointing towards the left side of the cistern.

Check for debris in botttom of cistern and clean if required.

Recommended hose configuration for PN900

